



File was found and ready to download!

UPDATED 14 HOURS AGO

Fastest Source: [usenet.nl](#)

Click the **download button** and select one of the found **cloud sources**.

6.4



2865 VIEWS

Download 

 SECURE SCANNED

You need to [log in](#) before you can post comments.



Navigation



Registration



FAQ

[Kts 570 Crack](#)

Extronic2.0

BOSCH BMW 741 / BMW / 530 d / E 60 / 5.0 / 570.0 kW / 090505 - 832067 / 30 42 3

DEMO ?

Vehicle info | Diagnosis | **Trouble shooting** | Maintenance | Circuit diagrams | Equipment

Engine management/EDC 10 C/P/ 35/35S trouble shooting instructions


Error code 4D23: Exhaust-gas pressure sensor before particulate filter: Hose plugged up 3 / 6

Fig.:

- * Plug connection of component B2.38 (Exhaust gas back pressure sensor).
- * View of terminals of wiring harness end plug connection.

Check power supply of the component B2.38 (Exhaust gas back pressure sensor):
Ignition off.
Plug connection of the component B2.38 (Exhaust gas back pressure sensor) unplugged.
Ignition on.
Set value(s):

- * Measurement on wiring harness end term. 1 (+) to term. 3 (-).
4,8...5,2 V Actual: **3.28 V**
- * Measurement on wiring harness end term. 1 (+) to ground.

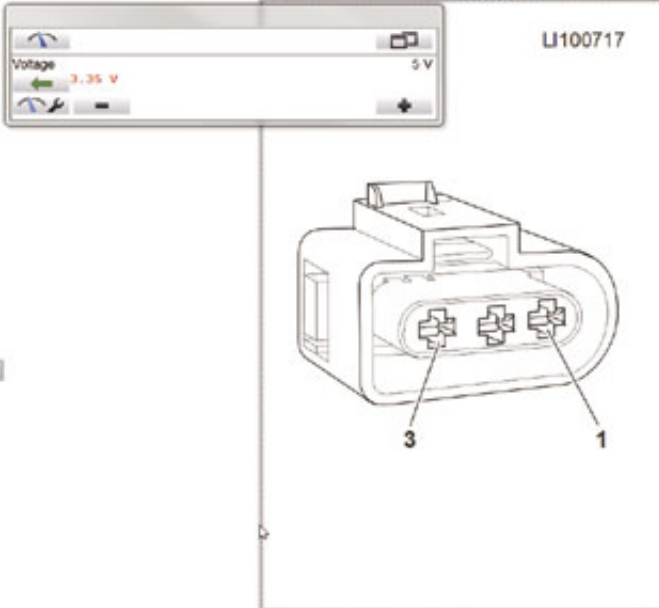

LI100717

Back Referen. info Continue

[Kts 570 Crack](#)



File was found and ready to download!

UPDATED 14 HOUES AGO

Fastest Source: [useenet.nl](#)

Click the **download button** and select one of the found **cloud sources**.

6.4



2865 VIEWS

Download 

 SECURE SCANNED

You need to [log in](#) before you can post comments.



Navigation



Registration



FAQ

TSB Technical Service Bulletins provide quick access to known faults on the car and displays a clear description of the cause symptoms and repair tips tested.. To provide the best solutions to our customers we have critically considered a wide range of products on the market to ensure that we only sell the best diagnostic tools.

e10c415e6f